

PRODUCT CHANGE NOTICE:


CHANGE DESCRIPTION Material change for Inpac products

| | Current Material | New Material | |
|-------------|--------------------------------|--------------------------------|--|
| Material | .88mm steel | 1.0mm steel (ST-BL 1.0330) | |
| Disting | Inside = Zinc plated | Inside and outside zinc plated | |
| Plating | Outside = Plastic coated | (DC01-B-M DIN EN 10130/10131) | |
| Powder Coat | RAL 7035, outside only | RAL 7035, inside and outside | |
| Grounding | With GND / earthing connection | | |

Technical properties are similar, but materials are different aesthetically.



New material (left), current Material (right), The exterior surface will be the same color, RAL 7035, but with a finer texture.

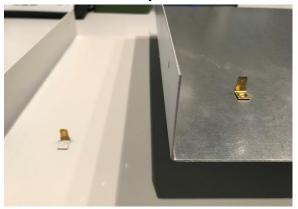

New material (left), current Material (right), All surfaces of the cover, including the interior, will be be powder coated.

REASON FOR THE CHANGE

Changing the material will mitigate sourcing constraints, minimize leadtime and ensure

consistent quality. The new material will also allow further customization, such as different color combinations.

PRODUCTS AFFECTED

All Inpac standard and custom kits, covers, and the 6U divider plate.

IMPLEMENTATION TIMELINE

The new part numbers will be available after May, 2018. Customers unable to transition to new material should place their final order before December 31, 2018.

| Height U | Depth (mm) | Current Part Number | New Part Number |
|-------------|---------------|------------------------|--------------------|
| 2 | 254.5 | 10828-071 | 10828-171 |
| 2 | 314.5 | 10828-072 | 10828-172 |
| 2 | 374.5 | 10828-073 | 10828-173 |
| 3 | 254.5 | 10828-051 | 10828-151 |
| 3 | 314.5 | 10828-052 | 10828-152 |
| 3 | 374.5 | 10828-053 | 10828-153 |
| 3 | 434.5 | 10828-054 | 10828-154 |
| 4 | 254.5 | 10828-056 | 10828-156 |
| 4 | 314.5 | 10828-057 | 10828-157 |
| 4 | 374.5 | 10828-058 | 10828-158 |
| 4 | 434.5 | 10828-059 | 10828-159 |
| 6 | 374.5 | 10828-068 | 10828-168 |
| 6 | 434.5 | 10828-069 | 10828-169 |